


Ferrites

A	36
H	60
F	18
L	54

Sa=21,6cm²

P=250VA

Kp=8/3 (2.67)
Ks=11/4 (2.75)

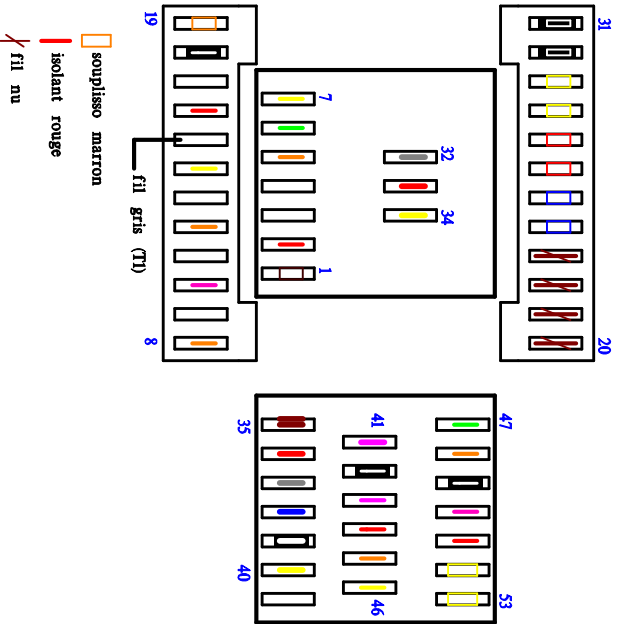

C	N	d	Br	C	N	d	Br
01	16	0.4	19-18	09	3	2x10	35-36
	16	0.4	18-16		1	2x10	36-37
	15	0.4	16-14		1.5	2x10	37-32
	15	0.4	14-12		1.5	2x10	32-38
	9	0.4	12-9		4	2x10	38-39
	6	0.4	10-8		2.5	1.0	39-33
	15	0.4	10-8		4.5	1.0	33-40
	15	0.4	8-7		2.5	0.6	40-34
	14	0.4	7-6		6.5	0.6	34-41
	14	0.4	6-5		9	0.4	41-42
	18	0.4	5-18		19	0.4	42-43
	03	91	0.4	10	14	0.4	43-44
	04	95	0.4		14	0.4	44-45
	05	93	0.4		14	0.4	45-46
	06	96	0.4		20	0.32	46-20
	07	93	0.4		7	0.32	47-48
	08	80	0.4		26	0.32	47-48
					43	0.32	48-49
					38	0.2	49-20
					17	0.2	50-51
					74	0.2	50-51
					18	0.32	52-53
					18	1.0	20-21
					18	0.6	26-27
					18	1.0	24-25
					18	0.6	28-29
					14	1.0	22-23
					18	0.6	30-31

C	N	d	Br
02	15	0.4	7-6
	15	0.4	8-7
	14	0.4	6-5
	14	0.4	5-18
	03	91	0.4
	04	95	0.4
	05	93	0.4
	06	96	0.4
	07	93	0.4
	08	80	0.4

